

## SERVICE BULLETIN

MANDATORY

FIX ON FAILURE

**INFORMATION ONLY**

**Ref: SRV-17-002**

**Date: 9-6-17**

**Product: AirFlex**

**Re: Divider Lock Assembly**

**Problem:** The dividers will fall off the end sheet or will become loose causing calibration issues by allowing the divider to move with the sensor.

**Solution:** The spring washers on the over center latch will become loose. The divider will not be held to the end sheet and can cause the latch to turn and allow the divider to fall off. In order to resolve the issue the spring washer arrangement has been changed. The number of the Belleville washers has been increased. This will increase the tension on the latch and hold the divider to the end sheet.

The two flat washers on the end of the latch, item 1 Figure 1 Part number 19940, are removed. Install two Belleville washers, Part number 26571, in their place as shown in Figure 2. The washers should be installed in pairs with the cupped side toward each other as shown.

If the customer is not going to take the divider off during transport the entire latch assembly can be removed and a 5/8"X4" bolt, nut and two flat washers can be used in the place of the latch.

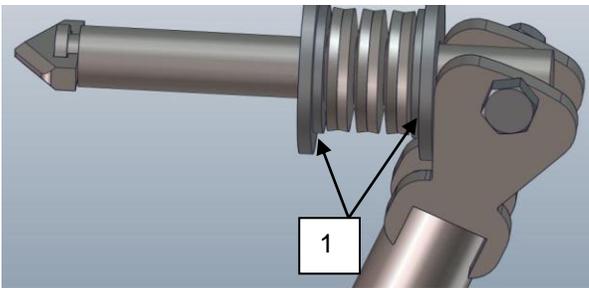


Figure 1



Figure 2

<b>Ordering Information:</b>		Per side
Qty	Part Number	Description
2	26571	Belleville Washers

If latch is removed		
Qty	Part Number	Description
1	19613	5/8"X4" Bolt
1	26883	5/8" nut
2	19926	5/8" Flat washers

**Labor Allowance: N/A**

**NOTE:**