



Honey Bee Manufacturing Ltd.

P.O. Box 120

Frontier, Sask. S0N 0W0

Phone (306) 296-2297

Fax (306) 296-2165

email: rick.norheim@honeybee.ca

SERVICE BULLETIN

INFORMATION ONLY	FIX ON FAILURE	MANDATORY X
------------------	----------------	--------------------

SV 09- 002

Date: Jan. 30, 2008

Product: All 2009 WS and GBH shipped from factory prior to Feb. 2, 2009.

Re: Reel arm lock bar.

Problem: Due to improperly manufactured parts the reel arm lock bar cannot be placed in lock position.

This is considered a safety issue by Honey Bee Manufacturing Ltd. and all non conforming part must be replaced immediately.

If correct lock bar has been factory installed please disregard this bulletin.

Solution: Replace incorrect part with correct part as per photo below.



G67229 Incorrect

P81619 Correct

Notice that the correct part has been cut with a radius to clear the cylinder yoke.

Parts Required: **P81619** - Reel Lift lock bar - Qty 2.
 70050 - Decal - Warning cyl. Lock - Qty 2.

Labor : 1 Hour

Reimbursement : All parts will be charged to a dealer's account and shipped prepaid.
 Parts and labor credit will be issued when a completed CF1 warranty claim form has been submitted to Honey Bee Mfg. Ltd.



Honey Bee Manufacturing Ltd.

P.O. Box 120

Frontier, Sask. S0N 0W0

Phone (306) 296-2297


Fax (306) 296-2165

email: rick.norheim@honeybee.ca

Reel Arm Lock Bar Replacement Instructions



Step 1: Using proper lifting device and lift strap, lift reel and remove weight from reel arm.

Figure 1

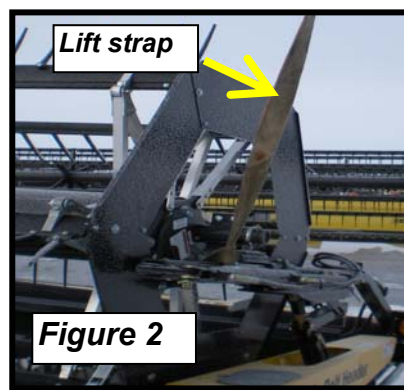

Step 2: Remove reel lock retaining pin.

Figure 2 & 3

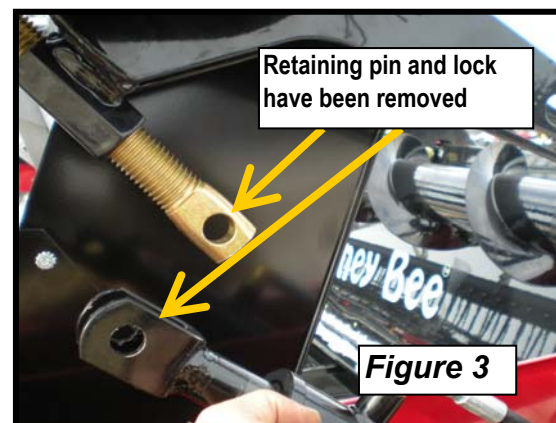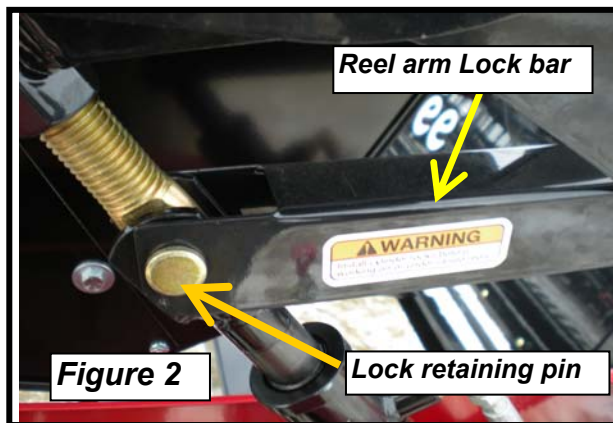

Step 3: Install replacement reel arm lock bar and replace pin, both right and left side.

Step 4: Lower reel and remove lift strap.