



Honey Bee Manufacturing Ltd.
P.O. Box 120
Frontier, Sask. S0N 0W0
Phone (306) 296-2297
Fax (306) 296-2165
Email: alton.norheim@honeybee.ca

SERVICE BULLETIN

MANDATORY

FIX ON FAILURE

INFORMATION ONLY

Ref: SRV-023-001

Date: 2-23-2023

Product: AirFlex and Grain Belt Headers on Claas Combines

Re:

Problem:

The pin latch handle on the Claas adapters will contact the shield for the dust suppression belt on Claas combines with the dust extractor. This contact will cause the shield to be pressed into the belt and can rub on the drive belt. Figure 1 and Figure 2



Figure 1



Figure 2

Solution:

To stop the belt from rubbing the latch on the pin handle must be modified. This will not affect the operation of the latches.

The portion of the latch that contacts the shields needs to be removed so it cannot damage the shields. Figure 3

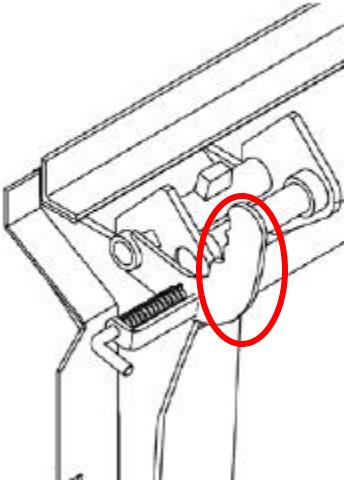


Figure 3

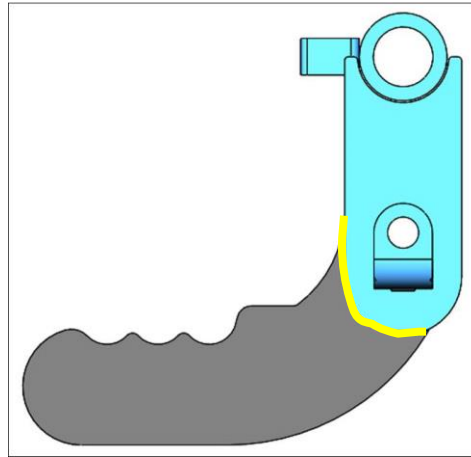


Figure 4

A saw or cut off wheel can be use to take the end of the latch off. Remove the entire handle and grind smooth any rough edges. Figure 4

This will leave the pin latch only. Figure 5 and Figure 6

This change was made to Model Year 2023 adapters.



Figure 5



Figure 6

Ordering Information:

No parts are needed

Labor Allowance: N/A

NOTE: